

A

1

power wire brush clean top of existing glulam beam
(to be inspected prior to new repairs installed)

new 2x12 (DF #1) laminations

2'-2"±

1'-9 5/8"

4 1/8"

4 7/8"±

6"

8"

6"

6"

1'-15 5/8"

2'-9"±

exist fascia plate

existing drilled holes

8" min staggered joints

random repairs to be determined on site

- route out existing lamination to solid wood
- install similar sized lamination (DF #1) c/w epoxy resin adhesive

wire brush clean ends of existing glulam beam
(to be inspected prior to new repairs installed)

2 new 2x12 (DF #1) laminations

new epoxy resin adhesive between laminations

New Glulam Beam Repairs

Scale: 1" = 1'-0"

SK-6

Glulam Beam Repairs
Terry Sawchuk Arena
901 Kimberley Ave
Winnipeg, MB R2K 4B9



GC ENGINEERING LTD.
675 ELM ST.
WINNIPEG MB R3M 3N8
PH (204) 793-3948
EMAIL CALGRAY@LIVE.CA