


NORTH




BEARING NORTH ABUTMENT

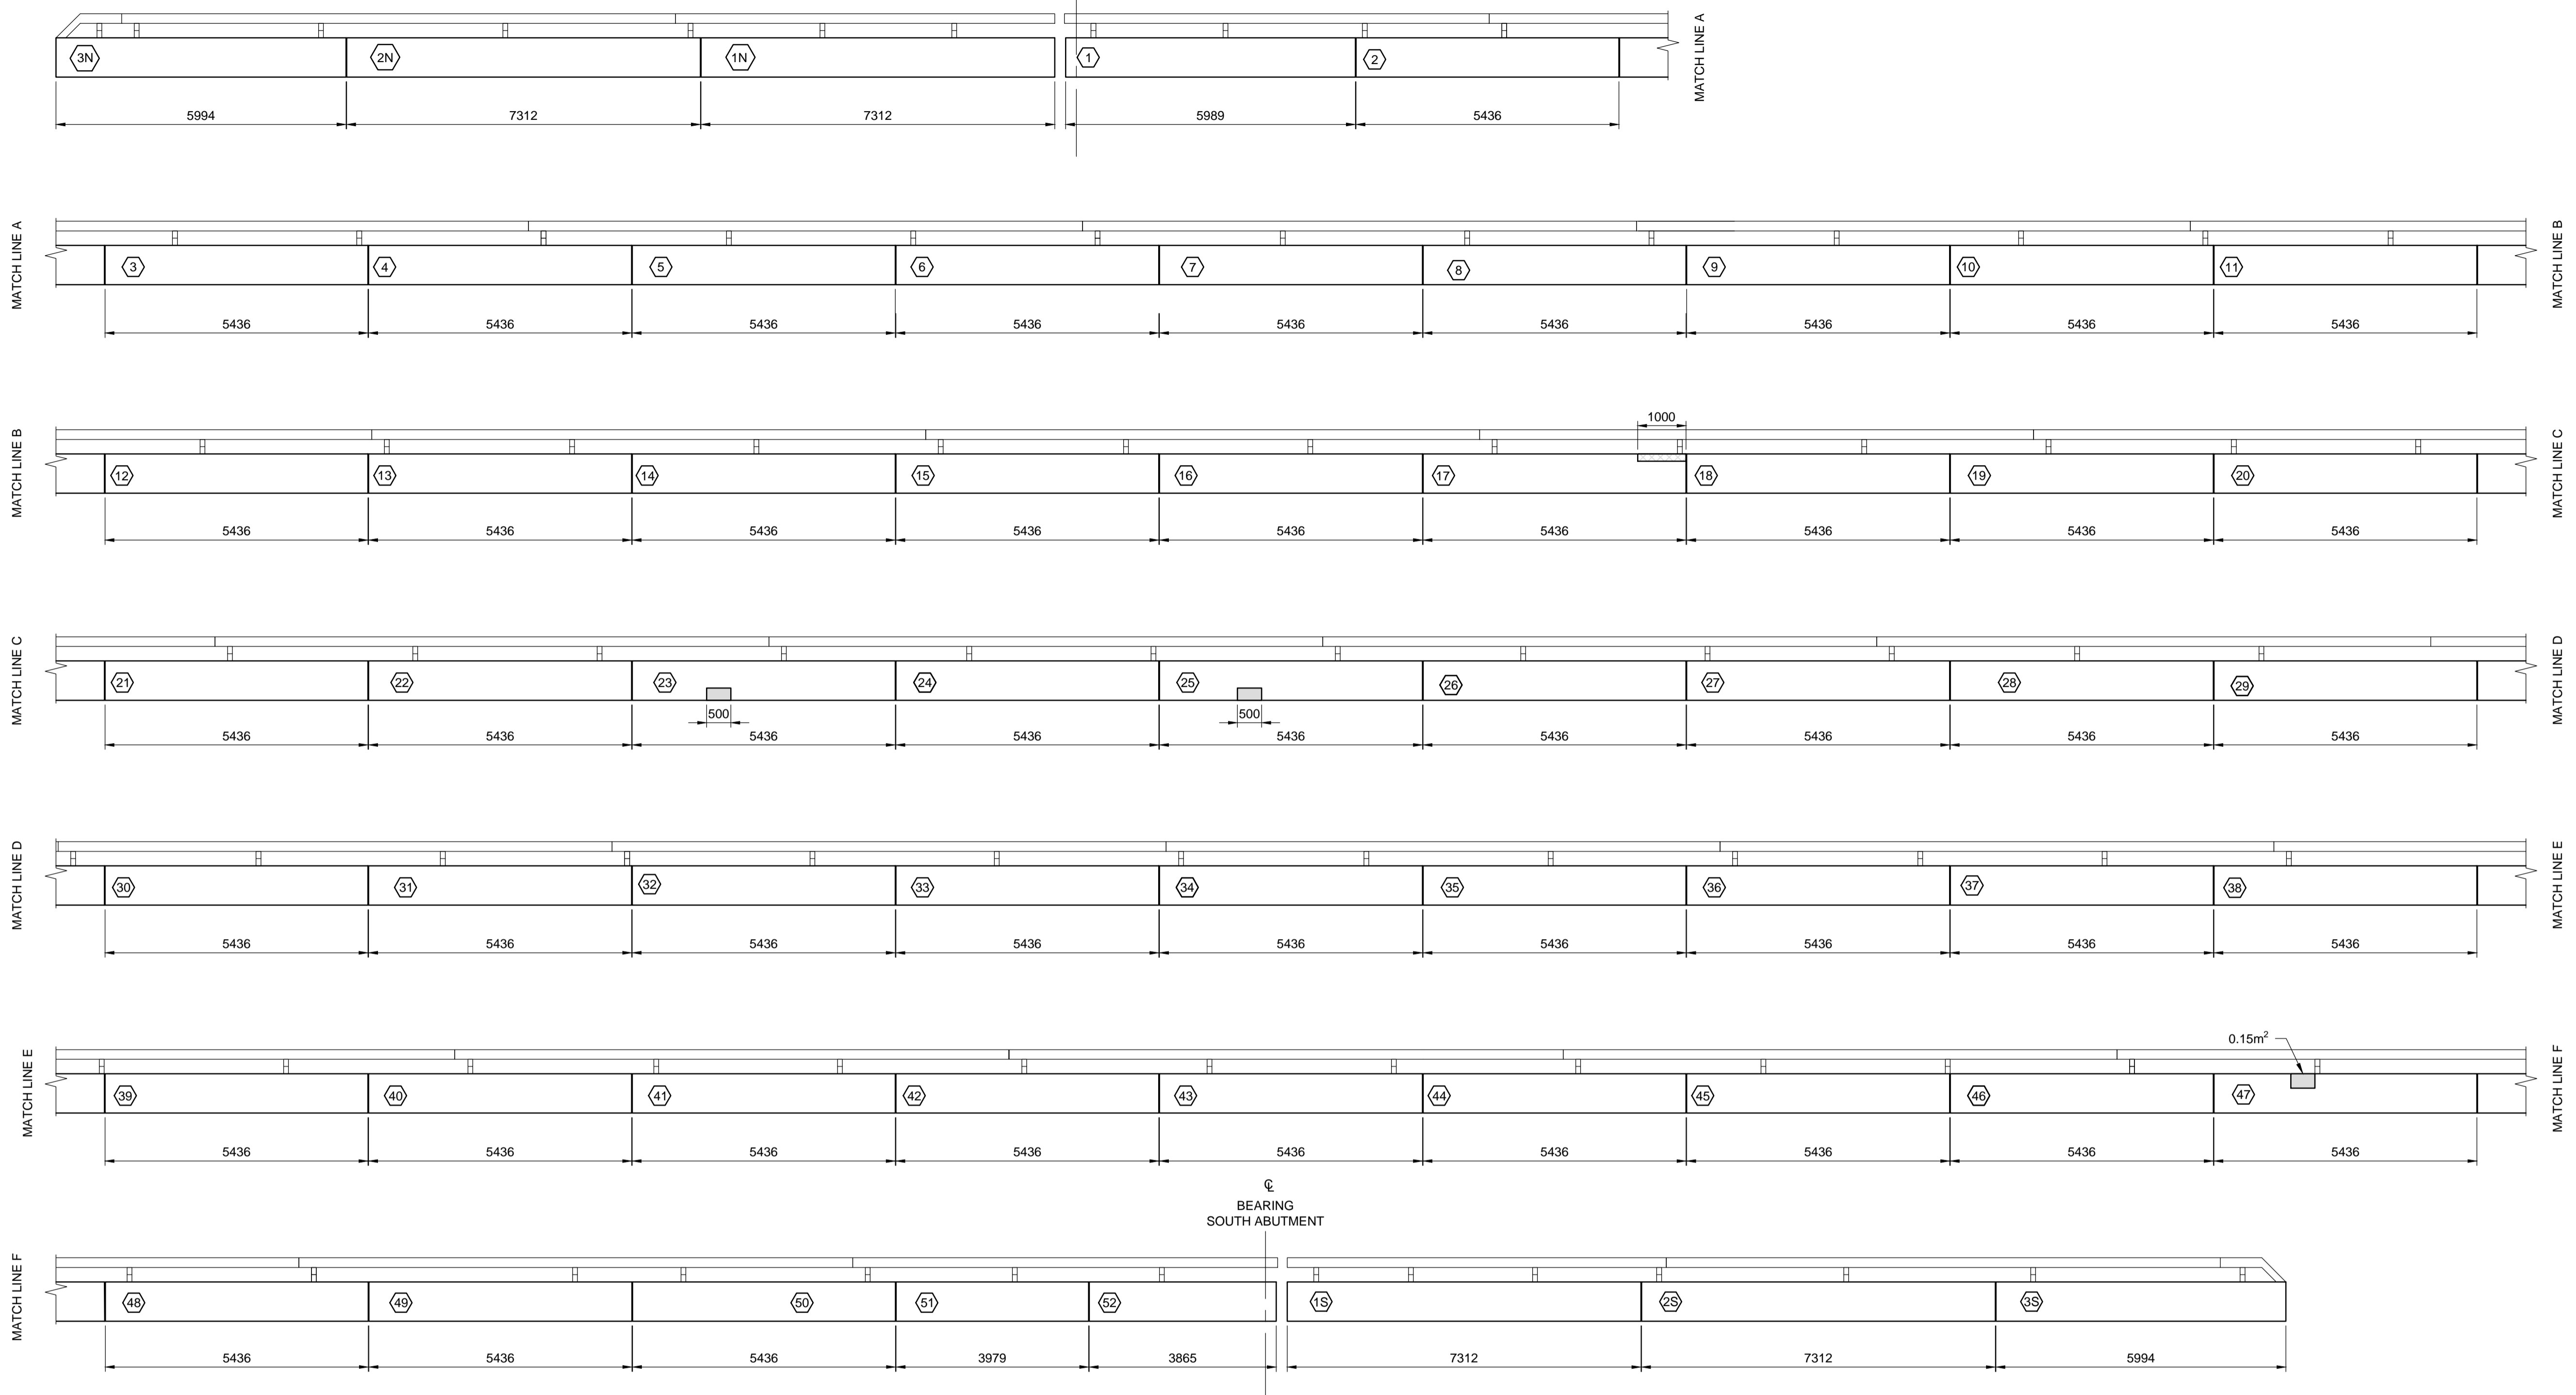

NORTH BOUND CURB LANE BARRIER ELEVATION

1:75
LOOKING EAST

REPAIR LEGEND

-  TYPE 1 CONCRETE BARRIER REPAIR
-  TYPE 2 CONCRETE BARRIER REPAIR
-  BARRIER LOCATION NO.

APPROXIMATE QUANTITY

- 1.0 m
- 0.41 m²

NOTES:


1. DIMENSIONS SHOWN OF EXISTING BARRIERS ARE APPROXIMATE.
2. DIMENSIONS SHOWN OF REPAIR AREAS ARE APPROXIMATE. LAYOUT ACTUAL REPAIR AREAS WITH CONTRACT ADMINISTRATOR ON SITE.
3. SEE SPECIFICATION FOR REPAIR PREPARATION & CONCRETE REPLACEMENT DETAILS.

METRIC

WHOLE NUMBERS INDICATE MILLIMETRES
DECIMALIZED NUMBERS INDICATE METRES



B.M. ELEV.	DESIGNED BY	DRA
	DRAWN BY	KB
	CHECKED BY	SSR
	APPROVED BY	RJT
	HOR. SCALE	-
	VERTICAL	VERTICAL
0 ISSUED FOR TENDER	02/25/17	RJT
NO. REVISIONS	DATE	BY
	DATE	FEBRUARY 24, 2017

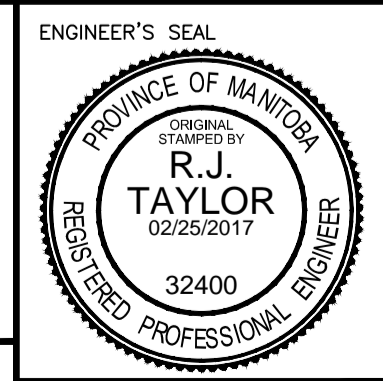

THE CITY OF WINNIPEG
PUBLIC WORKS DEPARTMENT

2017 BRIDGE MAINTENANCE - MIDTOWN BRIDGE & ST. VITAL BRIDGE REPAIRS

ST. VITAL BARRIER REPAIR LAYOUT 2

CITY DRAWING NUMBER B116-17-04
SHEET 15 OF 17
CONSULTANT DRAWING NUMBER --

CONSULTANT PROJECT NUMBER 17-5199